FLUKE.

374 FC/375 FC/376 FC

Clamp Meters

Users Manual

September 2015 Rev. 2, 4/20 © 2015-2020 Fluke Corporation. All rights reserved. Specifications are subject to change without notice. All product names are trademarks of their respective companies.



LIMITED WARRANTY AND LIMITATION OF LIABILITY

This Fluke product will be free from defects in material and workmanship for three years from the date of purchase. This warranty does not cover fuses, disposable batteries, or damage from accident, neglect, misuse, alteration, contamination, or abnormal conditions of operation or handling. Resellers are not authorized to extend any other warranty on Fluke's behalf. To obtain service during the warranty period, contact your nearest Fluke authorized service center to obtain return authorization information, then send the product to that Service Center with a description of the problem.

THIS WARRANTY IS YOUR ONLY REMEDY. NO OTHER WARRANTIES, SUCH AS FITNESS FOR A PARTICULAR PURPOSE, ARE EXPRESSED OR IMPLIED. FLUKE IS NOT LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OR LOSSES, ARISING FROM ANY CAUSE OR THEORY. Since some states or countries do not allow the exclusion or limitation of an implied warranty or of incidental or consequential damages, this limitation of liability may not apply to you.



Table of Contents

| Title | Page |
|-----------------------|------|
| Introduction | 1 |
| Contact Fluke | 2 |
| Safety Information | 3 |
| Replacement Part List | 9 |
| The Product | |
| Specifications | 22 |

i



Introduction

The Fluke 374 FC/375 FC/376 FC (the Product) measures true-rms ac current and voltage, dc current and voltage, inrush current, resistance, and capacitance. The 375 FC and 376 FC also measure frequency and dc millivolts. The detachable iFlex (Flexible Current Probe) that is included with the 376 FC (optional with the 374 FC and 375 FC) expands the measurement range to 2500 A ac. The Flexible Current Probe provides increased display flexibility and allows measurements of awkward sized conductors and improved wire access. The illustrations in this manual show the 376 FC.



Safety Information

A **Warning** identifies conditions and procedures that are dangerous to the user. A **Caution** identifies conditions and procedures that can cause damage to the Product or the equipment under test.

Symbols used on the Product and in this manual are explained in Table 1.

<u>∧</u> Marning

To prevent possible electrical shock, fire, or personal injury:

- Carefully read all instructions.
- Read all safety information before you use the Product.
- Use the Product only as specified, or the protection supplied by the Product can be compromised.
- Do not use the Product around explosive gas, vapor, or in damp or wet environments.
- Do not use and disable the Product if it is damaged.
- Do not use the Product if it operates incorrectly.



Users Manual

- Prior to use, ensure the Product is clean, dry, and in good repair. Do not use the
 product if has been exposed to water, cleaning solutions, battery electrolyte
 leakage, or other contaminants that may have entered the enclosure. These
 contaminants can reduce or eliminate the protection provided by the Product
 against electric shock or arc explosion. Have the product dried, cleaned, or
 repaired as necessary to ensure continued safe operation
- Use only correct measurement category (CAT), voltage, and amperage rated probes, test leads, and adapters for the measurement.
- Do not exceed the Measurement Category (CAT) rating of the lowest rated individual component of a Product, probe, or accessory.
- Comply with local and national safety codes. Use personal protective equipment (approved rubber gloves, face protection, and flame-resistant clothes) to prevent shock and arc blast injury where hazardous live conductors are exposed.
- Before each use, examine the Product. Look for cracks or missing pieces of the clamp housing or output cable insulation. Also look for loose or weakened components. Carefully examine the insulation around the jaws.
- Do not use test leads if they are damaged. Examine the test leads for damaged insulation and measure a known voltage.
- Do not touch voltages >30 V ac rms, 42 V ac peak, or 60 V dc.
- Do not measure current while the test leads are in the input jacks.
- Do not apply more than the rated voltage, between the terminals or between each terminal and earth ground.



Clamp Meters Safety Information

- De-energize the circuit or wear personal protective equipment in compliance with local requirements before you apply or remove the Flexible Current Probe.
- Measure a known voltage first to make sure that the Product operates correctly.
- Limit operation to the specified measurement category, voltage, or amperage ratings.
- The battery door must be closed and locked before you operate the Product.
- Remove all probes, test leads, and accessories before the battery door is
- Keep fingers behind the finger guards on the probes.
- Hold the Product behind the tactile barrier.
- Replace the batteries when the low battery indicator shows to prevent incorrect
- Do not use the HOLD function to measure unknown potentials. When HOLD is turned on, the display does not change when a different potential is measured.
- Disconnect power and discharge all high-voltage capacitors before you measure resistance, continuity, capacitance, or a diode junction.
- Remove the input signals before you clean the Product.
- Use only specified replacement parts.



Users Manual

- When batteries are changed, ensure that the calibration seal in the battery compartment is not damaged. If damaged, the Product may not be safe to use. Return the Product to Fluke for replacement of the seal.
- Do not use in CAT III or CAT IV environments without the protective cap of test probe. The protective cap decreases the exposed probe metal <4mm. This decreases the possibility of arc flash from short circuits.
- Do not place magnet inside Category IV panel. Place it outside the panel instead.

For safe operation and maintenance of the Product:

- Repair the Product before use if the battery leaks.
- · Have an approved technician repair the Product.

∆ Caution

To avoid possible damage to the Product or to equipment under test:

- Use the proper jacks, function, and range for the measurement application.
- Clean the case and accessories with a damp cloth and mild detergent only. Do not use abrasives or solvents.

Note

The Measurement Category (CAT) and voltage rating of any combination of test probe, test probe accessory, current clamp accessory, and the Product is the LOWEST rating of any individual component.



Table 1. Symbols

| Symbol | Description | Symbol | Description |
|----------|---|------------------------|---|
| ~ | AC (Alternating Current) | Ī | Earth |
| H | DC (Direct Current) | A | WARNING. HAZARDOUS VOLTAGE. Risk of electric shock. |
| CE | Conforms to European Union directives. | Δ | WARNING. RISK OF DANGER. |
| i | Consult user documentation. | (± | Battery. Low battery when shown on display. |
| | Double Insulated | 4 | Application around and removal from uninsulated hazardous live conductors is permitted. |
| <u></u> | Conforms to relevant Australian EMC standards. | ⊕ _{∪s} | Certified by CSA Group to North American safety standards. |
| ® | Do not apply to or remove from HAZARDOUS LIVE conductors. Do not apply around or remove from uninsulated hazardous live conductors without taking additional protective measures. | | |



Users Manual

Table 2. Symbols (Cont.)

| Symbol | Meaning |
|----------|--|
| CATII | Measurement Category II is applicable to test and measuring circuits connected directly to utilization points (socket outlets and similar points) of the low-voltage MAINS installation. |
| САТШ | Measurement Category III is applicable to test and measuring circuits connected to the distribution part of the building's low-voltage MAINS installation. |
| CAT II | Measurement Category IV is applicable to test and measuring circuits connected at the source of the building's low-voltage MAINS installation. |
| <u> </u> | This product complies with the WEEE Directive marking requirements. The affixed label indicates that you must not discard this electrical/electronic product in domestic household waste. Product Category: With reference to the equipment types in the WEEE Directive Annex I, this product is classed as category 9 "Monitoring and Control Instrumentation" product. Do not dispose of this product as unsorted municipal waste. |



Replacement Part List

Table 3 lists the available replacement parts.

Table 3. Replacement Parts

| Item | Qty. | Fluke Part or Model Number |
|---------------------------------|------|----------------------------|
| Battery, AA 1.5 V | 2 | 376756 |
| Battery Door Assembly | 1 | 4696918 |
| Test lead set | 1 | TL75 |
| Flexible current probe i2500-10 | 1 | 3676410 |
| Flexible current probe i2500-18 | 1 | 3798105 |
| Magnet strap | 1 | 669952 |
| STRAP 9 INCHES | 1 | 669960 |
| Soft Case | 1 | 3752958 |



Users Manual

The Product


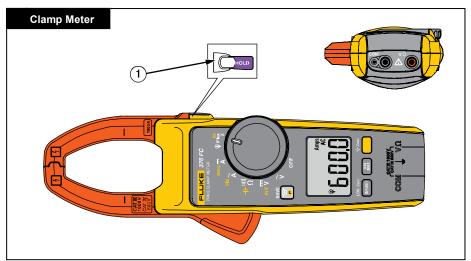


fig01.emf



Clamp Meters The Product



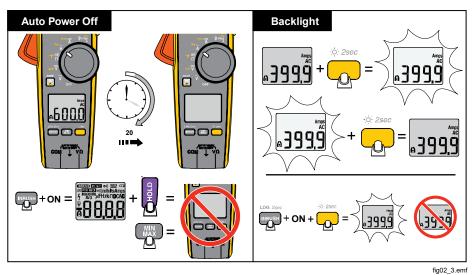

374 FC/375 FC/376 FC Users Manual


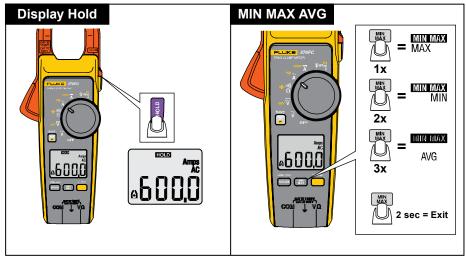


fig04_5.emf

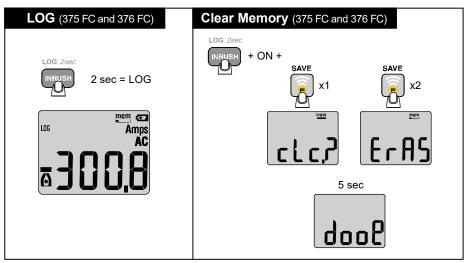

Clamp Meters The Product



fig_16.emf



374 FC/375 FC/376 FC Users Manual


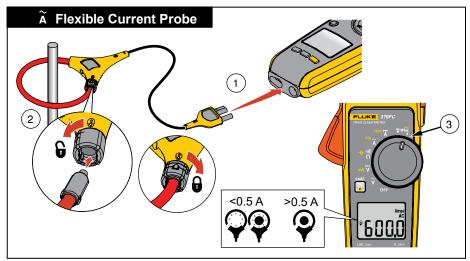


fig06.emf



Clamp Meters The Product



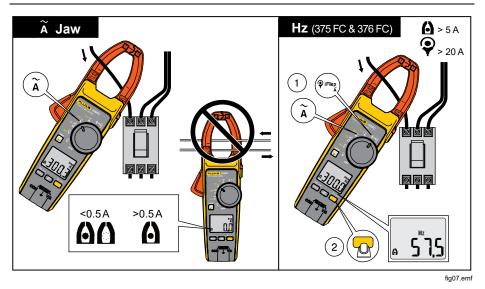

Users Manual


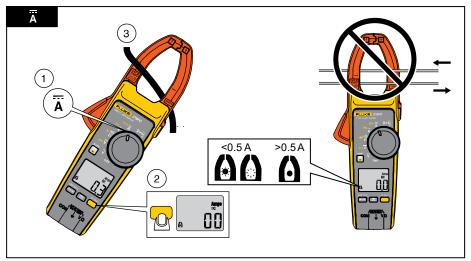


Fig08.emf



Clamp Meters The Product



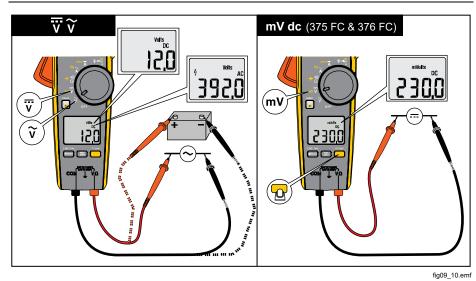

Users Manual

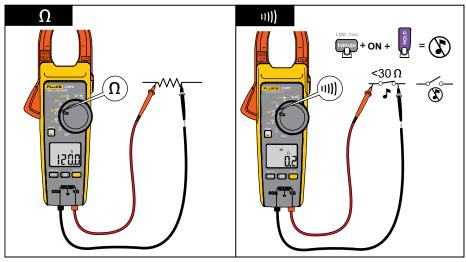


Fig15.emf

Clamp Meters The Product

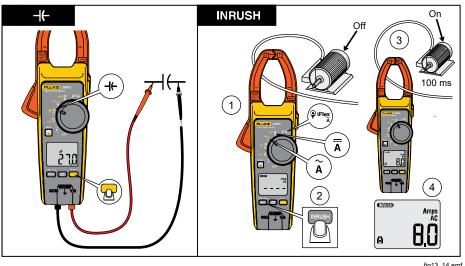


fig13_14.emf




374 FC/375 FC/376 FC Users Manual

3

fig11_12.emf



Clamp Meters The Product

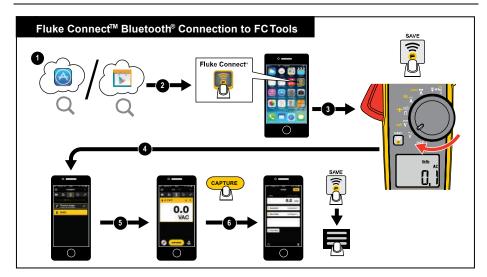



Users Manual

Specifications

| Maximum voltage between any Terminal and Earth Ground | 1000 V |
|---|---|
| Batteries | 2 AA, NEDA 15A, IEC LR6 |
| Operating Temperature | 10 °C to +50 °C |
| Storage Temperature | 40 °C to +60 °C |
| Operating Humidity | Non condensing (< 10°C) ≤90 % RH (at 10 °C to 30 °C) ≤75 % RH (at 30 °C to 40 °C) ≤45 % RH (at 40 °C to 50 °C) |
| Operating Altitude | , |
| Storage Altitude | 12 000 m |
| Size (L x W x H) | 249 mm x 85 mm x 45 mm |
| Weight | 410 g |
| Jaw Opening | 34 mm |
| Flexible Current Probe Diameter | 7.5 mm |
| Flexible Current Probe Cable Length (head to electronics connector) | 1.8 m |



Clamp Meters Specifications

Safety.....IEC 61010-1, Pollution Degree 2

IEC 61010-2-032: CAT III 1000V / CAT IV 600V

IEC 61010-2-033: CAT III 1000V / CAT IV 600V

Ingress Protection (IP) Rating.....IEC 60529: IP30

Radio Frequency Certification......FCC ID:T68-FBLE IC:6627A-FBLE

Wireless Radio Frequency Range2412 MHz to 2462 MHz

Output Power<100 mW

Electromagnetic Compatibility (EMC)

International IEC 61326-1: Portable, Electromagnetic Environment, IEC 61326-2-2

CISPR 11: Group 1, Class A

Group 1: Equipment has intentionally generated and/or uses conductively-coupled radio frequency energy that is necessary for the internal function of the equipment itself.

Class A: Equipment is suitable for use in all establishments other than domestic and those directly connected to a low-voltage power supply network that supplies buildings used for domestic purposes. There may be potential difficulties in ensuring electromagnetic compatibility in other environments due to conducted and radiated disturbances. Emissions that exceed the levels required by CISPR 11 can occur when the equipment is connected to a test object.



Note: Add 2 % for C.F. >2

Users Manual

| Temperature Coefficients | Add 0.1 x specified accuracy for each degree C above 28 °C or below 18 °C |
|----------------------------|---|
| AC Current via Jaw | |
| Range | |
| 374 FC and 375 FC | 600.0 A |
| 376 FC | 999.9 A |
| Resolution | 0.1 A |
| Accuracy | 2 % ± 5 digits (10 Hz to 100 Hz) |
| | 2.5 % ±5 digits (100-500 Hz) |
| Crest Factor (50 Hz/60 Hz) | |
| 376 FC | 3 @ 500 A |
| | 2.5 @ 600 A |
| | 1.42 @ 1000 A |
| 374 FC and 375 FC | 2.5 @ 350 A |

1.42 @ 600 A



Clamp Meters Specifications

AC Current via Flexible Current Probe

| Range | .2500 A |
|----------------------------|--------------------------------|
| Resolution | .0.1 A (≤999.9 A) |
| | 1 A (≤2500 A) |
| Accuracy | .3 % ±5 digits (5 Hz – 500 Hz) |
| Crest Factor (50 Hz/60 Hz) | .3.0 @ 1100 A |
| | 2.5 @ 1400 A |
| | 1.42 @ 2500 A |
| | Add 2 % for C.F. >2 |



Users Manual

Position Sensitivity

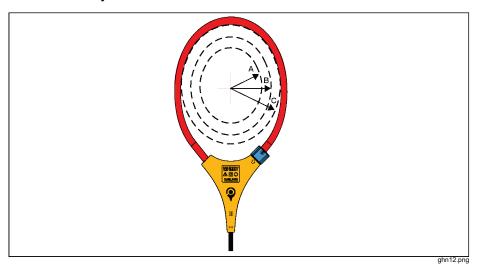


Figure 1. Position Sensitivity



Clamp Meters Specifications

| Distance from Optimum | i2500-10 Flex | i2500-18 Flex | Error |
|--------------------------|------------------|------------------|--------|
| А | 0.5 in (12.7 mm) | 1.4 in (35.6 mm) | ±0.5 % |
| В | 0.8 in (20.3 mm) | 2.0 in (50.8 mm) | ±1.0 % |
| С | 1.4 in (35.6 mm) | 2.5 in (63.5 mm) | ±2.0 % |

Measurement uncertainty assumes centralized primary conductor at optimum position, no external electrical or magnetic field, and within operating temperature range.

DC Current

Range

| 374 FC and 375 FC | 600.0 A |
|-------------------|---------------|
| 376 FC | 999.9 A |
| Resolution | 0.1 A |
| Accuracy | 2 % +5 digits |



Users Manual

| AC Voltage | |
|---------------------------|----------------------------------|
| Range | . 1000 V |
| Resolution | .0.1 V (≤600.0 V) |
| | 1 V (≤1000 V) |
| Accuracy | .1 % ±5 digits (20 Hz to 500 Hz) |
| DC Voltage | |
| Range | . 1000 V |
| Resolution | .0.1 V (≤600.0 V) |
| | 1 V (≤1000 V) |
| Accuracy | .1 % ±5 digits |
| mV dc (375 FC and 376 FC) | |
| Range | .500.0 mV |
| Resolution | .0.1 mV |

Accuracy 1 % ±5 digits



Clamp Meters Specifications

Frequency via Jaw

Range

Frequency via Flexible Current Probe

Range



Users Manual

| Resistance | |
|-------------------|-------------------|
| Range | |
| 374 FC | . 6000 Ω |
| 375 FC and 376 FC | .60 kΩ |
| Resolution | |
| 374 FC | .0.1 Ω (≤600 Ω) |
| | 1 Ω (≤6000 Ω) |
| 375 FC and 376 FC | .0.1 Ω (≤600 Ω) |
| | 1 Ω (≤6000 Ω) |
| | 10 Ω (≤60 kΩ) |
| Accuracy | .1 % ±5 digits |
| Capacitance | |
| Range | .1000 μF |
| Resolution | .0.1 μF (≤100 μF) |
| | 1 μF (≤1000 μF) |
| Accuracy | .1 % ±4 digits |

