



The protection tubes listed below are designed for use in high temperature corrosive service applications. These protection tubes can be used in waste incineration, cement kilns, lime kilns, and other harsh process environments where high levels of sulfur, chlorides, ash, and salt deposits are commonly found. The series 12 protection tube is also an excellent choice for immersion into molten copper and brass alloys. The series 71 and series 18 protection tubes are typically used as outer protection tubes in high temperature applications such as ceramic kilns, brick kilns, and steel melting furnaces. These tubes are excellent choices in applications where direct flame impingement occurs.


TUBE CODE 18JC

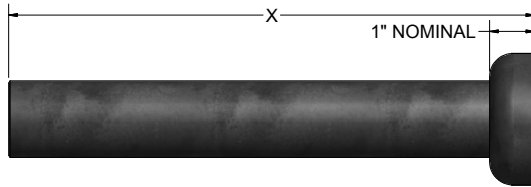


TUBE CODE 18J

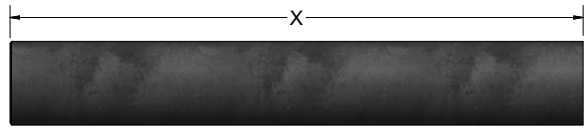

TUBE CODE 71BH

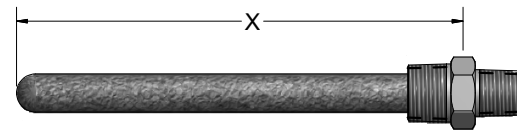

TUBE CODE 12

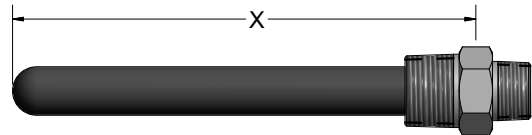

ORDER CODES

Example Order Number:

12W4 - 24 - 8,NT

1

Metal Ceramic (LT-1) 1371 °C [2500 °F]					
CODE	I.D. (inches)	O.D. (inches)	FITTING DESCRIPTION	PROCESS THREADS (inches)	TERM THREADS (inches)
12WH	5/8	7/8	Steel hex fitting	1	3/4
12W(E)	5/8	7/8	Steel pipe nipple (specify "E" length)	1	1
Silicate-Bonded Silicon Carbide 1649 °C [3000 °F]					
18J	1	1(3/4)	Plain tube	None	None
18JC	1	1(3/4)	Tube with 3" O.D. collar	None	None
Recrystallized Silicon Carbide (RSiC) 1600 °C [2912 °F]					
71BH	3/8	11/16	Steel hex fitting	3/4	1/2
71B(E)	3/8	11/16	Steel pipe nipple (specify "E" length)	3/4	3/4
71WH	1/2	7/8	Steel hex fitting	1	3/4
71W(E)	1/2	7/8	Steel pipe nipple (specify "E" length)	1	1

2 Tube "X" Length

LENGTH (inches)
12
18
24
30
36
42
48

3 Options

CODE	DESCRIPTION
8	316 SS nipple or hex tube fitting
NT	No process mounting threads on pipe nipples